

Measuring Motor Shaft Voltage and Bearing Currents with the Fluke 190 Series II ScopeMeter

Application Note

Voltage pulses from a variable speed drive can couple from a motor's stator to its rotor, causing a voltage to appear on the rotor shaft. When this rotor shaft voltage exceeds the insulating capacity of the bearing grease, flashover currents (sparking) can occur, causing pitting and fluting

of the motor bearing race, damage that can cause a motor to fail prematurely. This application note explains how to use the Fluke 190 Series II ScopeMeter® and a shaft voltage probe to measure motor shaft voltage and bearing currents.

Shaft voltage and bearing currents

Capacitive coupling between a motor's windings and rotor can create a voltage on a motor shaft. For this reason, bearings in electric motors can suffer from wear and tear caused not only by the rotation of the shaft but also by electric currents flowing from the motor shaft to ground by way of the bearings. Motors powered by sine wave ac power may have a shaft/bearing-toframe voltages of about 1 V to 2 V. Motors powered by the rapidly switching waveforms of variable speed drives, however, may have shaft/bearing to frame voltages as high as 8 V to 15 V. Voltages at these levels can overcome the insulating properties of bearing grease, and the resulting sparks can cause pitting, fluting, fusion craters, and eventually, premature failure of the bearings and motor.

Shaft voltage probe

Measuring the voltage of a rapidly spinning motor shaft can be difficult and dangerous. A shaft voltage probe helps to make shaft voltage measurements safer and more convenient by extending your reach, making the electrical connection to a motor shaft by means of a small conductive brush. The reference contact of the probe is connected to ground at the motor housing.

Measuring device

Shaft voltage and current spikes caused by the pulse-widthmodulated output of motor drives can be exceedingly brief, often in the microsecond measurement range. The high bandwidth (up to 200 MHz) and fast sampling rate (up to 2.5 gigasamples/second) of the Fluke 190 Series II ScopeMeter® make it ideally suited for measuring rapidly changing voltages and



Measuring motor shaft voltage with an Aegis shaft voltage probe (Photo courtesy of Electro Static Technology).



The Fluke 190 Series II ScopeMeter can simultaneously record and display four signals.



Fluting of a bearing race caused by bearing currents (Photo courtesy of Electro Static Technology).



currents—far superior to a digital multimeter. Connect-and-View™ triggering automatically displays stable waveforms with virtually any signal, while ScopeRecord™ enables you to store waveforms in memory for later viewing. And because 190 Series II ScopeMeters can record and display four signals, you can simultaneously view both current and voltage from more than one source.


Measurement results

The oscilloscope screen capture shows three measurements that were made with a Fluke 190 Series II ScopeMeter on a motor and drive.

• Channel A (red trace) shows motor shaft voltage. Spikes can clearly be seen from the flashovers on the shaft through the bearing.

- Channel B (blue trace) shows the common mode current, some of which passes through the bearing. The spikes give a clear indication of when a peak occurs, confirming a flash or spark.
- Channel C (black trace) shows the output of the motor drive. The quality of this signal determines the efficiency of the motor. A fast rise time in conjunction with a high electrical capacity of the stator/ rotor will contribute to the flashovers.

The ScopeMeter® is useful for a wide range of additional tests on motors and drives, including analysis of harmonics present in the supply voltage, using the built-in fast Fourier transform (FFT) software. Because harmonics play an important role on the efficiency of the motor, it is useful to know about their presence and amplitudes.

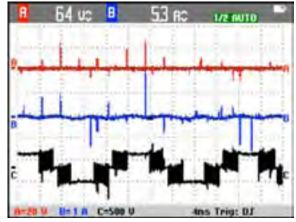

Shaft voltage, common-mode current, and motor drive output displayed on a Fluke 190 Series II ScopeMeter®.

Fluke. Keeping your world up and running.®

Fluke Corporation

PO Box 9090, Everett, WA 98206 U.S.A.

Fluke Europe B.V. PO Box 1186, 5602 BD Eindhoven, The Netherlands

For more information call:

In the U.S.A. (800) 443-5853 or Fax (425) 446-5116 In Europe/M-East/Africa +31 (0) 40 2675 200 or Fax +31 (0) 40 2675 222 In Canada (800)-36-FLUKE or Fax (905) 890-6866 From other countries +1 (425) 446-5500 or Fax +1 (425) 446-5116 Web access: http://www.fluke.com

©2011 Fluke Corporation. Specifications subject to change without notice. Printed in U.S.A. 1/2011 3985924A A-EN-N

Modification of this document is not permitted without written permission from Fluke Corporation.