

www.cedesa.com.mx

FLUKE®

The Fluke 62 Mini Infrared Thermometer

Non-contact temperature measurement

Non-contact diagnostic tool The Fluke 62 Mini infrared thermometer is a non-contact diagnostic tool for quick basic temperature checks in applications where a technician is close to the target object. Simple to use, the Fluke 62 Mini enables technicians to discover temperature discrepancies before they become problems. Professionals can troubleshoot maintenance problems by measuring surface temperatures of motors, electrical equipment, insulated walls and pipes, heating, ventilation and refrigeration systems all from a safe distance.

Features include:


- Temperature measurement range up to 500 °C (932 °F)
- High-resolution optics
- Accurate to within ± 1 % of reading
- MAX temperature display
- Laser sighting
- Backlit display

Compact and convenient, the Fluke 62 Mini thermometer makes troubleshooting quick and easy and is useful anywhere that temperature plays a role in product quality or equipment maintenance. The single dot laser indicates the center of the target; the large temperature display provides current and MAX surface temperatures.

Optical resolution
Use the Fluke 62 Mini within six feet of the intended target. At greater distances, the measured area will be larger (approximately the distance divided by 10). The Fluke offset single-point laser indicates the approximate center of the measurement area.

Technical Data



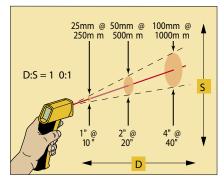

The single dot laser system indicates the approximate center of the measurement area.



Specifications

-30 °C to 500 °C (-20 °F to 932 °F)
10 °C to 30 °C (50 °F to 86 °F): ± 1 °C (2 °F)
Outside 10 °C to 30 °C (50 °F to 86 °F):
± 1.5 °C (3 °F) or ± 1. 5 % of reading,
whichever is greater
± 0.5 % of reading or $\leq \pm 1$ °C (± 2 °F), whichever is greater
Preset 0.95
< 500 mSec
10:1 calculated @ 8 0 % energy
6.5–18 microns thermopile detector
0.2 °C (0.5 °F)
•
•
°C or °F selectable
0 to 50 °C (32 to 120 °F)
10-9 0 % RH non-condensing, @ up to 30 °C (86 °F)
Up to 2 m (6 f t)
Single off set laser
200 g (7 oz); 152 x 101 x 38 mm (6 x 4 x 1.5 in)
9 V Alkaline battery (included)
12 h ours
-20 °C to 65 °C (-4 °F to 150 °F) without battery
Includes protective boot and storage holster
2 years (conditional)



Ordering information

Fluke 6 2 Mini Infrared Thermometer

Included: Storage Pouch



Fluke. Keeping your world up and running.

Componentes Electrónicos y Dispositivos Especiales s.a. de c.v

Hacienda La Muralla No. 136, CP. 76180 Jardines de la Hacienda. Querétaro, Méx.

ventas @cedesa.com.mx

☐ Tel.: +52 (442) 212 20 12

©2005 Fluke Corporation. All rights reserved. Printed in U.S.A. 4/2005 2437622 D-US-N Rev A



